


to 18-12-2020

Signed by Client


Report Date: 19-12-2020 Week: 51-2020 Period: 12-12-2020 to 18-12-2020

Project	: Dredging, Land Reclamation and Revetment Works at Gulhifalhu	Document number	: 462.10062-WQR-30.2
Contract number	: AGR(471)-PIDS2/PRIV/2019/194	Contractor	: Boskalis Westminster Contracting Ltd
Project number [MIAS]	: 462.10042	Client	: Ministry of National Planning and Infrastructure
		Attention	: shaana.farooq@planning.gov.mv


Surface Turbidity Measurements at the Reclamation Area

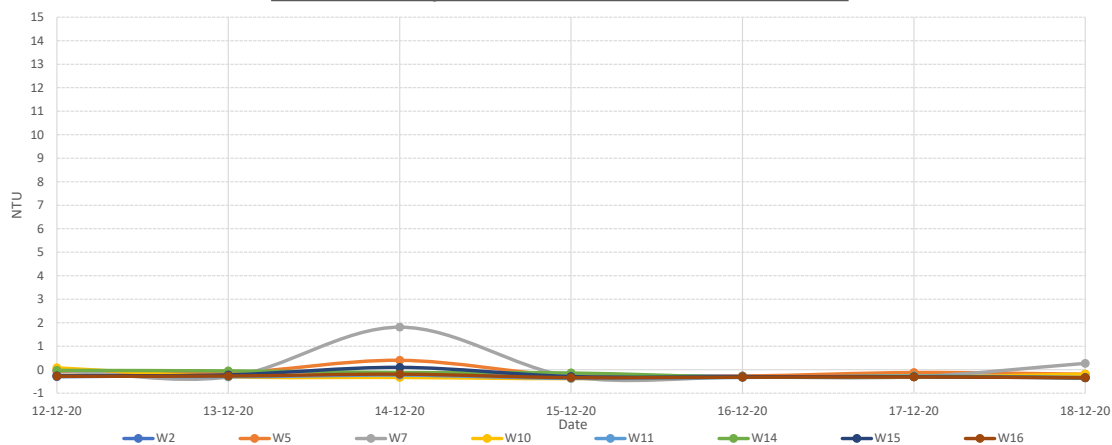

Mid Water Turbidity Measurements at the Reclamation Area

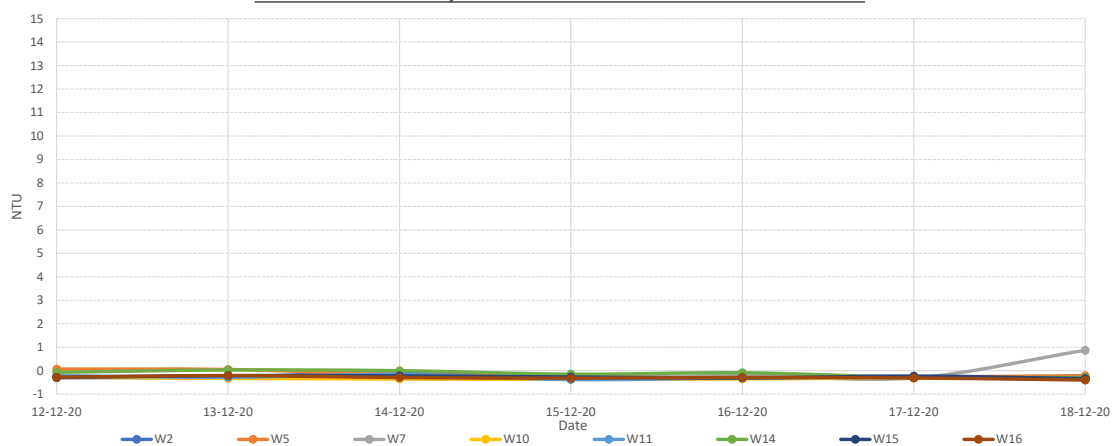

Bottom Turbidity Measurements at the Reclamation Area

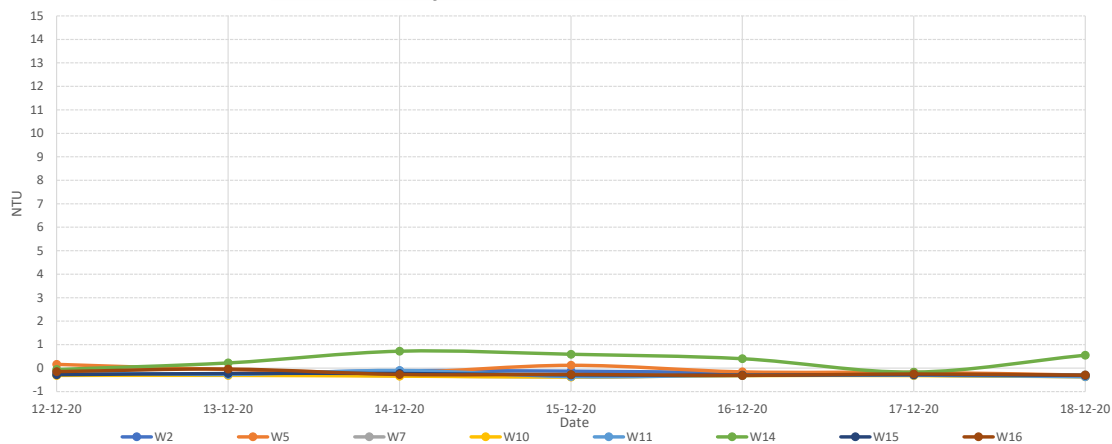



WATER QUALITY REPORT

Dredging, Land Reclamation and Revetment Works at Gulhifalhu



Date: 12-12-2020

Time: 7:40 to 9:40


Project : Dredging, Land Reclamation and Revetment Works at Gulhifalhu □ Document number : 462.10062-WQR-30.4
Contract number : AGR(471)-PIDS2/PRIV/2019/194 Contractor : Boskalis Westminster Contracting Ltd
Project number [MIAS] : 462.10042 Client : Ministry of National Planning and Infrastructure
Attention : shaana.farooq@planning.gov.mv

Results

Location	Section	Depth (m)	Temperature (°C)	pH	Conductivity (uS/cm)	Turbidity (NTU)
W2	Surface	1	29.3	6.8	55097	-0.30
	Mid-water	12	29.3	6.8	55063	-0.30
	Bottom	24	29.3	6.8	55050	-0.29
W5	Surface	1	29.3	4.6	55027	-0.08
	Mid-water	12	29.2	4.5	55011	0.07
	Bottom	22	29.2	4.6	54987	0.16
W7	Surface	1	29.3	5.7	54981	-0.03
	Mid-water	12	29.3	5.6	55091	-0.23
	Bottom	24	29.3	5.6	55051	-0.22
W10	Surface	1	29.2	6.1	55051	0.08
	Mid-water	12	29.2	6.2	55080	-0.27
	Bottom	23	29.3	6.2	55078	-0.31
W11	Surface	2	29.3	6.4	55128	-0.24
	Mid-water	7	29.3	6.4	55100	-0.22
	Bottom	16	29.3	6.5	55103	-0.16
W14	Surface	1	29.3	6.9	55030	-0.03
	Mid-water	8	29.3	6.9	55034	-0.07
	Bottom	17	29.3	6.9	55029	-0.06
W15	Surface	1	29.3	5.2	54967	-0.26
	Mid-water	12	29.3	6.0	54983	-0.29
	Bottom	24	29.3	6.3	54926	-0.28
W16	Surface	1	29.3	6.6	55072	-0.28
	Mid-water	12	29.3	6.7	55069	-0.28
	Bottom	22	29.2	6.7	55038	-0.15
W19	Surface					
	Mid-water					
	Bottom					
W20	Surface					
	Mid-water					
	Bottom					
W25	Surface					
	Mid-water					
	Bottom					
W26	Surface					
	Mid-water					
	Bottom					
W27	Surface					
	Mid-water					
	Bottom					
W36	Surface					
	Mid-water					
	Bottom					
W45	Surface					
	Mid-water					
	Bottom					
W46	Surface					
	Mid-water					
	Bottom					
W47	Surface					
	Mid-water					
	Bottom					
W51	Surface					
	Mid-water					
	Bottom					

Vessel	Stop	Start

Tides

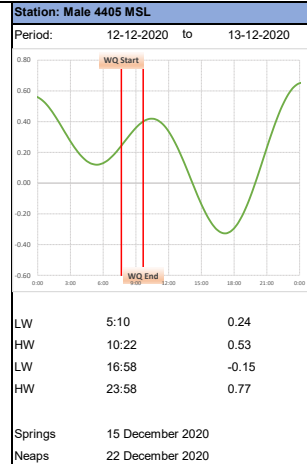


Remarks

Fairway completed the dredging phase of the works on the 20th of August, therefore as of the 25th only the Reclamation area locations are measured

Water samples taken from all reclamation sites for TSS testing

Weather in Male' Source: <https://www.foreca.com/101282027/Mal%C3%A9-Maldives/obs>

VRMM: Male International Airport - Met Station

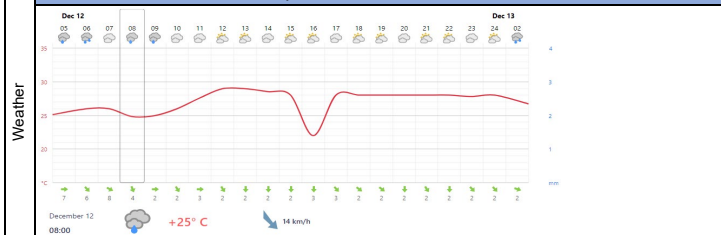

Time	Temp	Weather	Wind	Humidity	Pressure	Visibility
05:00	25 °C	Partly cloudy	10 km/h	80%	1010.0 mb	5 km
06:00	25 °C	Partly cloudy then sun	10 km/h	80%	1010.0 mb	5 km
07:00	25 °C	Light rain, drizzle	10 km/h	80%	1010.0 mb	7 km
08:00	25 °C	Light rain, drizzle then sun	10 km/h	80%	1010.0 mb	N/A
09:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
10:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
11:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
12:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
13:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
14:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
15:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
16:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
17:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A
18:00	25 °C	Partly sunny	10 km/h	80%	1010.0 mb	N/A

Source: <https://www.timeanddate.com/weather/maldives/male/historic>



WATER QUALITY REPORT

Dredging, Land Reclamation and Revetment Works at Gulhifalhu



Date: 13-12-2020


Time: 7:40 to 9:40

Project : Dredging, Land Reclamation and Revetment Works at Gulhifalhu □ Document number : 462.10062-WQR-30.5
Contract number : AGR(471)-PIDS2/PRIV/2019/194 Contractor : Boskalis Westminster Contracting Ltd
Project number [MIAS] : 462.10042 Client : Ministry of National Planning and Infrastructure
Attention : shaana.farooq@planning.gov.mv

Results


Location	Section	Depth (m)	Temperature (°C)	pH	Conductivity (uS/cm)	Turbidity (NTU)
W2	Surface	1	29.1	5.2	55279	-0.25
	Mid-water	12	29.1	5.3	55248	-0.27
	Bottom	22	29.1	5.4	55224	-0.24
W5	Surface	1	29.0	4.8	55250	-0.14
	Mid-water	12	29.0	4.9	55194	0.05
	Bottom	23	29.0	4.7	55176	-0.06
W7	Surface	1	29.0	5.5	54820	-0.31
	Mid-water	12	29.0	5.4	54864	-0.28
	Bottom	24	28.9	5.3	55062	-0.25
W10	Surface	1	29.0	3.9	54909	-0.30
	Mid-water	12	29.0	4.3	55007	-0.33
	Bottom	21	29.0	4.2	55048	-0.31
W11	Surface	1	29.2	4.0	55287	-0.30
	Mid-water	11	29.1	4.1	55292	-0.28
	Bottom	23	29.1	4.1	55229	-0.27
W14	Surface	1	29.2	5.5	55396	-0.05
	Mid-water	8	29.2	5.5	55269	0.03
	Bottom	17	29.1	5.4	55272	0.22
W15	Surface	1	29.1	4.6	55196	-0.22
	Mid-water	12	29.1	4.8	55172	-0.21
	Bottom	22	29.0	5.1	55173	-0.23
W16	Surface	1	29.2	4.9	55315	-0.27
	Mid-water	12	29.2	4.7	55257	-0.21
	Bottom	23	29.2	4.6	55238	-0.04
W19	Surface					
	Mid-water					
	Bottom					
W20	Surface					
	Mid-water					
	Bottom					
W25	Surface					
	Mid-water					
	Bottom					
W26	Surface					
	Mid-water					
	Bottom					
W27	Surface					
	Mid-water					
	Bottom					
W36	Surface					
	Mid-water					
	Bottom					
W45	Surface					
	Mid-water					
	Bottom					
W46	Surface					
	Mid-water					
	Bottom					
W47	Surface					
	Mid-water					
	Bottom					
W51	Surface					
	Mid-water					
	Bottom					

Vessel	Stop	Start

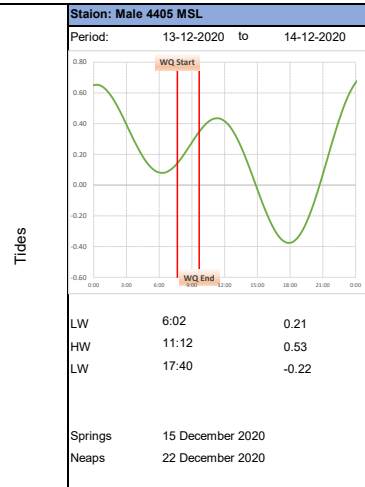

Fairway completed the dredging phase of the works on the 20th of August, therefore as of the 25th only the Reclamation area locations are measured

Weather

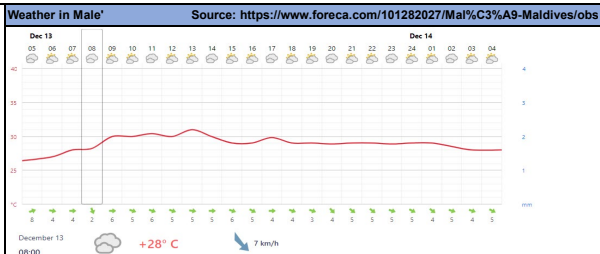

VRMM: Male International Airport - Met Station

Time	Temp	Wind	Humidity	Pressure	Visibility
06:00	27.1°C	Partly cloudy	75%	1011.0 hPa	5 km
07:00	28.1°C	Partly sunny	75%	1011.0 hPa	5 km
08:00	28.1°C	Partly sunny	75%	1012.0 hPa	N/A
09:00	28.1°C	Partly sunny	75%	1012.0 hPa	N/A
10:00	28.1°C	Broken clouds	75%	1012.0 hPa	N/A
11:00	28.1°C	Broken clouds	75%	1012.0 hPa	N/A
12:00	28.1°C	Broken clouds	75%	1011.0 hPa	N/A
13:00	28.1°C	Partly sunny	80%	1011.0 hPa	N/A
14:00	28.1°C	Partly sunny	75%	1009.0 hPa	N/A
15:00	28.1°C	Broken clouds	75%	1008.0 hPa	N/A
16:00	28.1°C	Broken clouds	75%	1008.0 hPa	N/A
17:00	28.1°C	Broken clouds	75%	1008.0 hPa	N/A
18:00	28.1°C	Partly cloudy	75%	1009.0 hPa	N/A

Source: <https://www.timeanddate.com/weather/maldives/male/historic>



WATER QUALITY REPORT

Dredging, Land Reclamation and Revetment Works at Gulhifalhu



Date: 14-12-2020

Time: 13:00 to 15:20

Project : Dredging, Land Reclamation and Revetment Works at Gulhifalhu □ Document number : 462.10062-WQR-30.6
Contract number : AGR(471)-PIDS2/PRIV/2019/194 Contractor : Boskalis Westminster Contracting Ltd
Project number [MIAS] : 462.10042 Client : Ministry of National Planning and Infrastructure
Attention : shaana.farooq@planning.gov.mv


Results

Location	Section	Depth (m)	Temperature (°C)	pH	Conductivity (uS/cm)	Turbidity (NTU)
W2	Surface	2	29.4	5.8	55277	-0.26
	Mid-water	12	29.3	5.7	55197	-0.06
	Bottom	24	29.3	5.7	55195	-0.11
W5	Surface	1	29.4	4.7	55154	0.40
	Mid-water	12	29.1	4.7	55144	-0.16
	Bottom	23	29.1	4.7	55137	-0.18
W7	Surface	1	29.4	4.9	55203	1.81
	Mid-water	12	29.1	4.6	55115	-0.34
	Bottom	21	29.0	4.5	55101	-0.33
W10	Surface	1	29.4	4.9	55198	-0.33
	Mid-water	11	29.1	4.7	55134	-0.35
	Bottom	23	28.4	4.4	55049	-0.34
W11	Surface	1	28.9	4.8	55150	-0.23
	Mid-water	12	29.0	4.5	55141	-0.16
	Bottom	23	28.1	4.0	55070	-0.10
W14	Surface	1	29.5	5.7	55206	-0.12
	Mid-water	11	29.1	5.6	55157	0.00
	Bottom	19	29.1	5.4	55179	0.72
W15	Surface	1	29.5	5.2	55139	0.10
	Mid-water	11	29.1	5.4	55101	-0.22
	Bottom	25	29.1	5.5	55081	-0.23
W16	Surface	1	29.5	5.5	55260	-0.19
	Mid-water	12	29.2	5.3	55202	-0.29
	Bottom	24	29.2	5.2	55156	-0.27
W19	Surface					
	Mid-water					
	Bottom					
W20	Surface					
	Mid-water					
	Bottom					
W25	Surface					
	Mid-water					
	Bottom					
W26	Surface					
	Mid-water					
	Bottom					
W27	Surface					
	Mid-water					
	Bottom					
W36	Surface					
	Mid-water					
	Bottom					
W45	Surface					
	Mid-water					
	Bottom					
W46	Surface					
	Mid-water					
	Bottom					
W47	Surface					
	Mid-water					
	Bottom					
W51	Surface					
	Mid-water					
	Bottom					

Stoppages


Vessel	Stop	Start

Tides

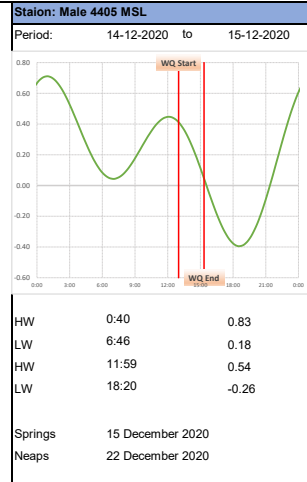

Remarks

Fairway completed the dredging phase of the works on the 20th of August, therefore as of the 25th only the Reclamation area locations are measured

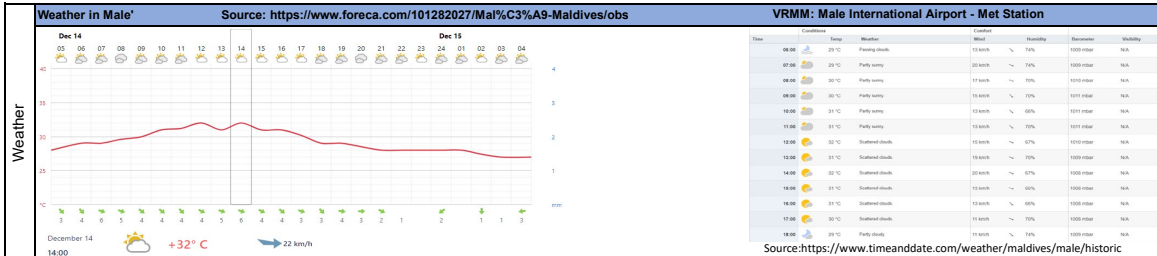



WATER QUALITY REPORT

Dredging, Land Reclamation and Revetment Works at Gulhifalhu



Date: 15-12-2020

Time: 12:00 to 13:50

Project : Dredging, Land Reclamation and Revetment Works at Gulhifalhu □
Contract number : AGR(471)-PIDS2/PRIV/2019/194
Project number [MIAS] : 462.10042

Document number : 462.10062-WQR-30.7
Contractor : Boskalis Westminster Contracting Ltd
Client : Ministry of National Planning and Infrastructure
Attention : shaana.farooq@planning.gov.mv


Results

Location	Section	Depth (m)	Temperature (°C)	pH	Conductivity (uS/cm)	Turbidity (NTU)
W2	Surface	2	29.2	5.9	54379	-0.27
	Mid-water	12	29.2	5.9	54660	-0.27
	Bottom	23	29.1	6.1	55139	-0.13
W5	Surface	1	29.2	5.2	54090	-0.27
	Mid-water	11	29.0	5.1	54477	-0.25
	Bottom	20	29.0	5.1	54825	0.12
W7A	Surface	1	29.3	5.6	53902	-0.30
	Mid-water	11	29.1	5.5	54692	-0.35
	Bottom	23	29.1	5.5	55087	-0.37
W10	Surface	2	29.2	5.5	54027	-0.38
	Mid-water	10	29.2	5.4	54676	-0.37
	Bottom	21	29.2	5.5	54846	-0.38
W11	Surface	1	29.1	5.9	55173	-0.37
	Mid-water	11	29.2	5.8	55002	-0.38
	Bottom	18	29.1	5.8	55082	-0.36
W14	Surface	1	29.3	5.6	55137	-0.14
	Mid-water	10	29.2	5.2	55204	-0.15
	Bottom	19	29.2	5.1	55200	0.59
W15	Surface	1	29.1	5.2	54247	-0.29
	Mid-water	10	29.0	5.2	54201	-0.27
	Bottom	23	29.0	5.2	54273	-0.29
W16	Surface	1	29.3	6.0	54214	-0.34
	Mid-water	12	29.1	5.9	55025	-0.32
	Bottom	22	29.1	5.9	55115	-0.27
W19	Surface					
	Mid-water					
	Bottom					
W20	Surface					
	Mid-water					
	Bottom					
W25	Surface					
	Mid-water					
	Bottom					
W26	Surface					
	Mid-water					
	Bottom					
W27	Surface					
	Mid-water					
	Bottom					
W36	Surface					
	Mid-water					
	Bottom					
W45	Surface					
	Mid-water					
	Bottom					
W46	Surface					
	Mid-water					
	Bottom					
W47	Surface					
	Mid-water					
	Bottom					
W51	Surface					
	Mid-water					
	Bottom					

Stoppages


Vessel	Stop	Start

Tides

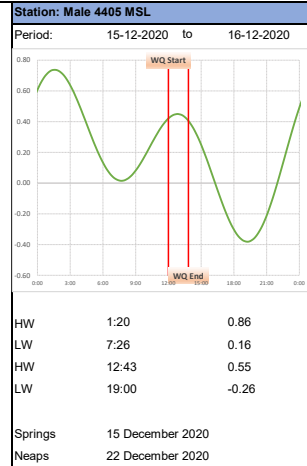

Remarks

Fairway completed the dredging phase of the works on the 20th of August, therefore as of the 25th only the Reclamation area locations are measured

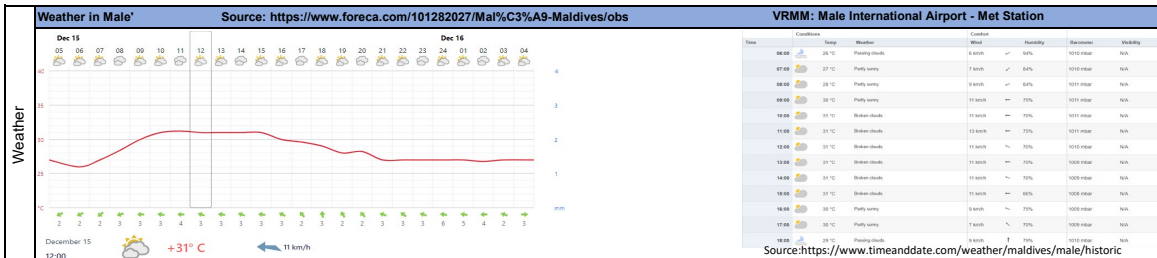



WATER QUALITY REPORT

Dredging, Land Reclamation and Revetment Works at Gulhifalhu




Date: 16-12-2020

Time: 11:00 to 13:20


Project : Dredging, Land Reclamation and Revetment Works at Gulhifalhu □ Document number : 462.10062-WQR-30.8
Contract number : AGR(471)-PIDS2/PRIV/2019/194 Contractor : Boskalis Westminster Contracting Ltd
Project number [MIAS] : 462.10042 Client : Ministry of National Planning and Infrastructure
Attention : shaana.farooq@planning.gov.mv

Location	Section	Depth (m)	Temperature (°C)	pH	Conductivity (uS/cm)	Turbidity (NTU)
W2	Surface	2	29.2	6.1	53529	-0.27
	Mid-water	12	29.1	6.1	54374	-0.26
	Bottom	24	29.1	6.1	54563	-0.20
W5	Surface	1	29.1	5.5	54069	-0.27
	Mid-water	12	29.1	5.3	54089	-0.28
	Bottom	23	29.0	5.2	54363	-0.16
W7	Surface	2	29.2	5.9	53355	-0.31
	Mid-water	12	29.0	5.9	54455	-0.20
	Bottom	23	28.9	5.8	54875	-0.31
W10	Surface	2	29.3	5.8	53266	-0.30
	Mid-water	12	29.2	5.8	53333	-0.35
	Bottom	25	29.0	5.1	54269	-0.32
W11	Surface	2	29.3	5.7	53311	-0.33
	Mid-water	12	29.0	5.8	54130	-0.31
	Bottom	22	29.0	5.0	55004	-0.31
W14	Surface	2	29.2	7.6	53322	-0.31
	Mid-water	10	29.3	7.8	55156	-0.09
	Bottom	19	29.2	8.0	55366	0.40
W15	Surface	1	29.1	4.9	54020	-0.30
	Mid-water	10	29.0	5.1	54828	-0.31
	Bottom	18	29.1	5.2	54912	-0.30
W16	Surface	2	29.2	5.7	54160	-0.32
	Mid-water	11	29.3	5.4	54317	-0.29
	Bottom	24	29.2	4.6	54774	-0.31
W19	Surface					
	Mid-water					
	Bottom					
W20	Surface					
	Mid-water					
	Bottom					
W25	Surface					
	Mid-water					
	Bottom					
W26	Surface					
	Mid-water					
	Bottom					
W27	Surface					
	Mid-water					
	Bottom					
W36	Surface					
	Mid-water					
	Bottom					
W45	Surface					
	Mid-water					
	Bottom					
W46	Surface					
	Mid-water					
	Bottom					
W47	Surface					
	Mid-water					
	Bottom					
W51	Surface					
	Mid-water					
	Bottom					

Stoppages	Vessel	Stop	Start

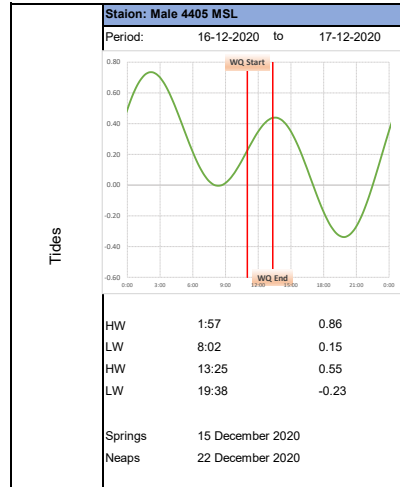

Fairway completed the dredging phase of the works on the 20th of August, therefore as of the 25th only the Reclamation area locations are measured

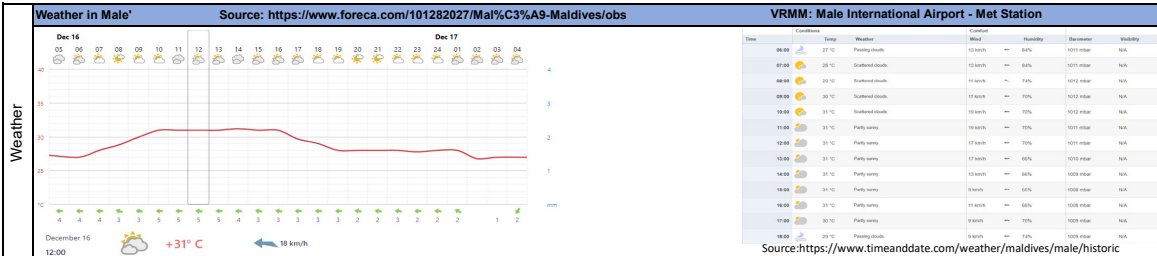



WATER QUALITY REPORT

Dredging, Land Reclamation and Revetment Works at Gulhifalhu



Date: 17-12-2020


Time: 7:20 to 9:20

Project : Dredging, Land Reclamation and Revetment Works at Gulhifalhu □ Document number : 462.10062-WQR-30.9
Contract number : AGR(471)-PIDS2/PRIV/2019/194 Contractor : Boskalis Westminster Contracting Ltd
Project number [MIAS] : 462.10042 Client : Ministry of National Planning and Infrastructure
Attention : shaana.farooq@planning.gov.mv

Results

Location	Section	Depth (m)	Temperature (°C)	pH	Conductivity (uS/cm)	Turbidity (NTU)
W2	Surface	1	29.0	5.3	53890	-0.30
	Mid-water	11	29.0	5.3	54421	-0.31
	Bottom	23	29.0	5.3	54695	-0.30
W5	Surface	1	28.9	4.7	53734	-0.12
	Mid-water	12	28.7	4.6	54218	-0.27
	Bottom	22	28.5	4.4	54720	-0.18
W7	Surface	1	29.0	5.5	53408	-0.30
	Mid-water	12	28.8	5.6	53821	-0.31
	Bottom	22	28.7	5.7	54292	-0.30
W10	Surface	1	29.0	5.7	53311	-0.31
	Mid-water	12	29.0	5.6	53657	-0.32
	Bottom	23	28.7	5.5	54618	-0.32
W11	Surface	1	29.0	5.8	53489	-0.27
	Mid-water	12	28.9	5.8	54037	-0.30
	Bottom	21	28.9	5.7	54539	-0.30
W14	Surface	2	29.0	5.4	53048	-0.28
	Mid-water	8	29.2	5.4	54386	-0.28
	Bottom	17	29.3	5.4	55208	-0.17
W15	Surface	2	28.9	3.6	53695	-0.30
	Mid-water	10	28.8	3.5	54121	-0.23
	Bottom	22	28.7	3.4	54624	-0.28
W16	Surface	2	29.0	5.5	53881	-0.31
	Mid-water	12	28.9	5.4	54345	-0.31
	Bottom	22	28.9	5.4	55011	-0.25
W19	Surface					
	Mid-water					
	Bottom					
W20	Surface					
	Mid-water					
	Bottom					
W25	Surface					
	Mid-water					
	Bottom					
W26	Surface					
	Mid-water					
	Bottom					
W27	Surface					
	Mid-water					
	Bottom					
W36	Surface					
	Mid-water					
	Bottom					
W45	Surface					
	Mid-water					
	Bottom					
W46	Surface					
	Mid-water					
	Bottom					
W47	Surface					
	Mid-water					
	Bottom					
W51	Surface					
	Mid-water					
	Bottom					

Vessel	Stop	Start

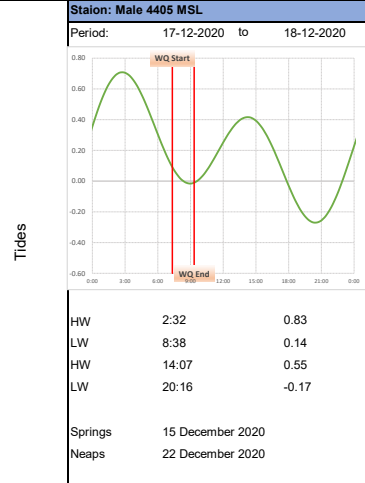


Remarks

Fairway completed the dredging phase of the works on the 20th of August, therefore as of the 25th only the Reclamation area locations are measured

Weather in Male' Source: <https://www.foreca.com/101282027/Mal%C3%A9-Maldives/obs>

VRMM: Male International Airport - Met Station

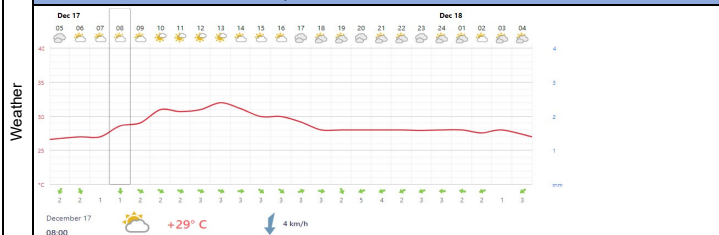

Time	Condition	Temp	Humidity	WindSpeed	Visibility
06:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
07:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
08:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
09:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
10:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
11:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
12:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
13:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
14:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
15:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
16:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
17:00	Partly cloudy	27 °C	5%	1011 mbar	N/A
18:00	Partly cloudy	27 °C	5%	1011 mbar	N/A

Source: <https://www.timeanddate.com/weather/maldives/male/historic>



WATER QUALITY REPORT

Dredging, Land Reclamation and Revetment Works at Gulhifalhu



Date: 18-12-2020

Time: 8:20 to 10:20


Project : Dredging, Land Reclamation and Revetment Works at Gulhifalhu □ Document number : 462.10062-WQR-30.10
Contract number : AGR(471)-PIDS2/PRIV/2019/194 Contractor : Boskalis Westminster Contracting Ltd
Project number [MIAS] : 462.10042 Client : Ministry of National Planning and Infrastructure
Attention : shaana.farooq@planning.gov.mv

Results

Location	Section	Depth (m)	Temperature (°C)	pH	Conductivity (uS/cm)	Turbidity (NTU)
W2	Surface	1	29.0	4.6	53791	-0.33
	Mid-water	12	28.9	4.8	54591	-0.35
	Bottom	22	28.9	4.9	54723	-0.35
W5	Surface	1	28.8	3.9	53686	-0.19
	Mid-water	12	28.8	4.0	53997	-0.21
	Bottom	23	28.8	4.0	54467	-0.30
W7	Surface	2	29.0	4.5	53703	0.27
	Mid-water	12	28.9	4.0	53675	0.87
	Bottom	23	28.6	3.9	53758	-0.28
W10	Surface	1	29.0	3.8	53434	-0.19
	Mid-water	12	28.8	3.8	53908	-0.34
	Bottom	22	28.2	3.6	54317	-0.37
W11	Surface	2	29.0	4.3	54071	-0.33
	Mid-water	12	28.9	4.2	54444	-0.34
	Bottom	19	28.9	4.2	54515	-0.37
W14	Surface	1	29.1	4.9	53432	-0.35
	Mid-water	8	29.1	4.9	54072	-0.29
	Bottom	17	29.4	5.0	55273	0.55
W15	Surface	1	28.8	3.9	53637	-0.35
	Mid-water	11	28.6	4.0	54183	-0.34
	Bottom	22	28.5	4.4	54607	-0.31
W16	Surface	1	28.9	4.7	53747	-0.34
	Mid-water	11	28.9	4.7	53725	-0.40
	Bottom	21	29.0	4.8	54701	-0.30
W19	Surface					
	Mid-water					
	Bottom					
W20	Surface					
	Mid-water					
	Bottom					
W25	Surface					
	Mid-water					
	Bottom					
W26	Surface					
	Mid-water					
	Bottom					
W27	Surface					
	Mid-water					
	Bottom					
W36	Surface					
	Mid-water					
	Bottom					
W45	Surface					
	Mid-water					
	Bottom					
W46	Surface					
	Mid-water					
	Bottom					
W47	Surface					
	Mid-water					
	Bottom					
W51	Surface					
	Mid-water					
	Bottom					


Vessel	Stop	Start

Tides

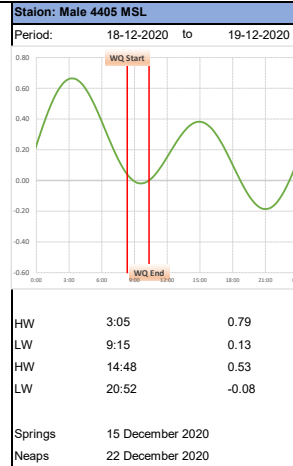

Remarks

Fairway completed the dredging phase of the works on the 20th of August, therefore as of the 25th only the Reclamation area locations are measured

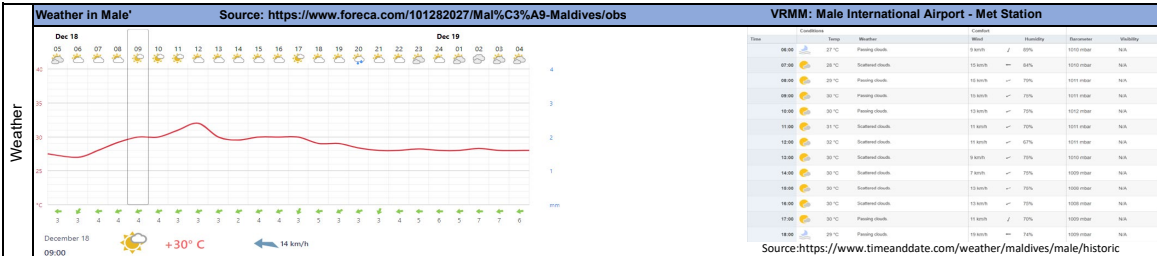

Male' Water & Sewerage Company Pvt Ltd**Water Quality Assurance Laboratory**

Quality Assurance Building, 1st Floor, Male' Hingun, Vilimale', Male' City, Maldives
Tel: +9603323209, Fax: +9603324306, Email: wqa@mwsc.com.mv

**WATER QUALITY TEST REPORT****Report No: 500185657****Customer Information:**

CDE Pvt Ltd
H.Orchidmaage, 4th Floor
Ameeru Ahmed Magu
Male K

Report date: **24/12/2020**Test Requisition Form No: **900190865**Sample(s) Recieved Date: **21/12/2020**Date of Analysis: **21/12/2020 - 21/12/2020**

Sample Description ~	GF_REC-W15	GF_REC-W05	GF_REC-W07	TEST METHOD	UNIT
Sample Type ~	Sea Water	Sea Water	Sea Water		
Sample No	83215478	83215479	83215480		
Sampled Date ~	12/12/2020 07:51	12/12/2020 08:06	12/12/2020 08:31		
PARAMETER	ANALYSIS RESULT				
Physical Appearance	Clear with particles	Clear with particles	Clear with particles	HACH Method 8006	mg/L
Total Suspended Solids	<5 (LoQ 5 mg/L)	<5 (LoQ 5 mg/L)	<5 (LoQ 5 mg/L)		

Keys: mg/L : Milligram Per Liter**Checked by**

Aminath Shahidha
Laboratory Executive

Approved by

Mohamed Eyman
Manager, Quality

Notes: Sampling Authority: Sampling was not done by MWSC Laboratory

This report shall not be reproduced except in full, without written approval of MWSC

This test report is ONLY FOR THE SAMPLES TESTED.

~ Information provided by the customer

Male' Water & Sewerage Company Pvt Ltd**Water Quality Assurance Laboratory**

Quality Assurance Building, 1st Floor, Male' Hingun, Vilimala', Male' City, Maldives
Tel: +9603323209, Fax: +9603324306, Email: wqa@mwsc.com.mv

**WATER QUALITY TEST REPORT**

Report No: 500185657

Customer Information:

CDE Pvt Ltd
H.Orchidmaage, 4th Floor
Ameeru Ahmed Magu
Male K

Report date: 24/12/2020

Test Requisition Form No: 900190865

Sample(s) Recieved Date: 21/12/2020

Date of Analysis: 21/12/2020 - 21/12/2020

Sample Description ~	GF_REC-W10	GF_REC-W11	GF_REC-W16	TEST METHOD	UNIT
Sample Type ~	Sea Water	Sea Water	Sea Water		
Sample No	83215481	83215482	83215483		
Sampled Date ~	12/12/2020 08:45	12/12/2020 08:56	12/12/2020 09:12		
PARAMETER	ANALYSIS RESULT				
Physical Appearance	Clear with particles	Clear with particles	Clear with particles		
Total Suspended Solids	<5 (LoQ 5 mg/L)	<5 (LoQ 5 mg/L)	<5 (LoQ 5 mg/L)	HACH Method 8006	mg/L

Keys: mg/L : Milligram Per Liter

Checked by

Aminath Shahidha
Laboratory Executive

Approved by

Mohamed Eyman
Manager, Quality

Notes: Sampling Authority: Sampling was not done by MWSC Laboratory

This report shall not be reproduced except in full, without written approval of MWSC

This test report is ONLY FOR THE SAMPLES TESTED.

~ Information provided by the customer

WATER QUALITY TEST REPORT
Report No: 500185657

Customer Information:

CDE Pvt Ltd
 H.Orchidmaage, 4th Floor
 Ameeru Ahmed Magu
 Male K

Report date: **24/12/2020**
 Test Requisition Form No: **900190865**
 Sample(s) Recieved Date: **21/12/2020**
 Date of Analysis: **21/12/2020 - 21/12/2020**

Sample Description ~	GF_REC-W02	GF_REC-W14	TEST METHOD	UNIT
Sample Type ~	Sea Water	Sea Water		
Sample No	83215484	83215485		
Sampled Date ~	12/12/2020 09:24	12/12/2020 09:32		
PARAMETER	ANALYSIS RESULT			
Physical Appearance	Clear with particles	Clear with particles	HACH Method 8006	mg/L
Total Suspended Solids	<5 (LoQ 5 mg/L)	<5 (LoQ 5 mg/L)		

Keys: mg/L : Milligram Per Liter

Checked by



Aminath Shahidha
 Laboratory Executive

Approved by



Mohamed Eyman
 Manager, Quality

Notes: Sampling Authority: Sampling was not done by MWSC Laboratory
 This report shall not be reproduced except in full, without written approval of MWSC
 This test report is ONLY FOR THE SAMPLES TESTED.
 ~ Information provided by the customer

***** END OF REPORT *****